## FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL HARDWARE

NUMBER: 05-6BA-2117 -X

SUBSYSTEM NAME: EPD&C - LANDING GEAR CONTROL

REVISION:	4	11/16/93		
PART DATA				

PART DATA			
	PART NAME VENDOR NAME	PART NUMBER VENDOR NUMBER	
LRU	:PANEL F6A5 (PRE-MEDS)	V070-730257	
LRU	:PANEL F8A5M(PRE-MEDS)	V070-730265	
LRU	:PANEL F6A3 (MEDS)	V070-730734	
LRU	:PANEL FBA3 (MEDS)	V070-730736	
SRU	:SWITCH, PUSHBUTTON .	ME452-0061-7146	

## EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

SWITCH, PUSHBUTTON, LANDING GEAR ARM, 4P2P (MOM), ILLUMINATED

REFERENCE DESIGNATORS:

34V73A6A5S1 (PRE-MEDS) 34V73A8A5S1 (PRE-MEDS)

34V73A6A3S6 (MEDS CONFIGURATION) 34V73A8A3S6 (MEDS CONFIGURATION)

QUANTITY OF LIKE ITEMS: 2

TWO

#### FUNCTION:

PROVIDES REDUNDANT MANUAL ON CONTROL OF 28VDC FROM CONTROL BUS TO LATCHING RELAYS FOR LANDING GEAR ARM CIRCUIT ACTUATION AND STATUS MONITORING. TWO IDENTICAL SWITCHES PROVIDE REDUNDANT CONTROL BUS POWER TO COMMON LOAD.

## FAILURE MODES EFFECTS ANALYSIS FMEA - CIL FAILURE MODE

NUMBER: 05-68A-2117-01

REVISION#: 6

07/01/99

SUBSYSTEM NAME: EPD&C - LANDING GEAR CONTROL

LRU: PANEL F6A5, F8A5 (PRE-MEDS), F6A3, F8F3 (MEDS)

CRITICALITY OF THIS

ITEM NAME: SWITCH, PUSHBUTTON

FAILURE MODE: 1R2

FAILURE MODE:

FAILS OPEN (THREE OR MORE POLES)

MISSION PHASE:

DO DE-ORBIT

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA

103 DISCOVERY

104 ATLANTIS

105 **ENDEAVOUR** 

GAUSE:

PIECE PART STRUCTURAL FAILURE, CONTAMINATION, VIBRATION, MECHANICAL SHOCK,

PROCESSING ANOMALY

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

A) PASS

B) PASS

C) PASS

PASS/FAIL RATIONALE:

A)

B)

C)

- FAILURE EFFECTS -

#### (A) SUBSYSTEM:

FIRST FAILURE - LOSS OF REDUNDANT LANDING GEAR ARM SWITCH. LOSS OF CAPABILITY TO APPLY POWER TO RELAYS SET COIL.

## (B) INTERFACING SUBSYSTEM(S):

# FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE NUMBER: 05-68A-2117- 01

FIRST FAILURE - NO EFFECT

#### (C) MISSION:

FIRST FAILURE - NO EFFECT

## (D) CREW, VEHICLE, AND ELEMENT(S):

FIRST FAILURE - NO EFFECT. REDUNDANT SWITCH PROVIDED. PILOT ALERTED. SECOND FAILURE (FAILURE OF REMAINING SWITCH) - POSSIBLE LOSS OF CREW/ VEHICLE BECAUSE LANDING GEAR FAILS TO DEPLOY DUE TO LOSS OF ELECTRICAL CONTROL/POWER TO LANDING GEAR ARM CIRCUITS.

#### (E) FUNCTIONAL CRITICALITY EFFECTS:

#### -DISPOSITION RATIONALE-

#### (A) DESIGN:

RÉFER TO APPENDIX A, ITEM NO. 3 - PUSHBUTTON SWITCH

#### (B) TEST:

REFER TO APPENDIX A, ITEM NO. 3 - PUSHBUTTON SWITCH

#### GROUND TURNAROUND TEST

ANY TURNAROUND CHECKOUT TESTING IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD.

#### (C) INSPECTION:

RÉFER TO APPENDIX A, ITEM NO. 3 - PUSHBUTTON SWITCH

## (D) FAILURE HISTORY:

CURRENT DATA ON TEST FAILURES, FLIGHT FAILURES, UNEXPLAINED ANOMALIES, AND OTHER FAILURES EXPERIENCED DURING GROUND PROCESSING ACTIVITY CAN BE FOUND IN THE PRACA DATA BASE.

## (E) OPERATIONAL USE:

NONE

## FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL FAILURE MODE NUMBER: 05-6BA-2117-01

- APPROVALS -

EDITORIALLY APPROVED TECHNICAL APPROVAL

: BNA

: VIA APPROVAL FORM

: 1. Kimura 7/6/99 : 96-CIL-011\_05-68A(2)